

# Drawings

## EJA430E Gauge Pressure Transmitter Bottom Process Connection


DPharp EJA®

SD 01C31E01-02EN

[Style: S1, S2]

Unit: mm (approx. inch)


### • Bottom Process Connection (Installation code B)

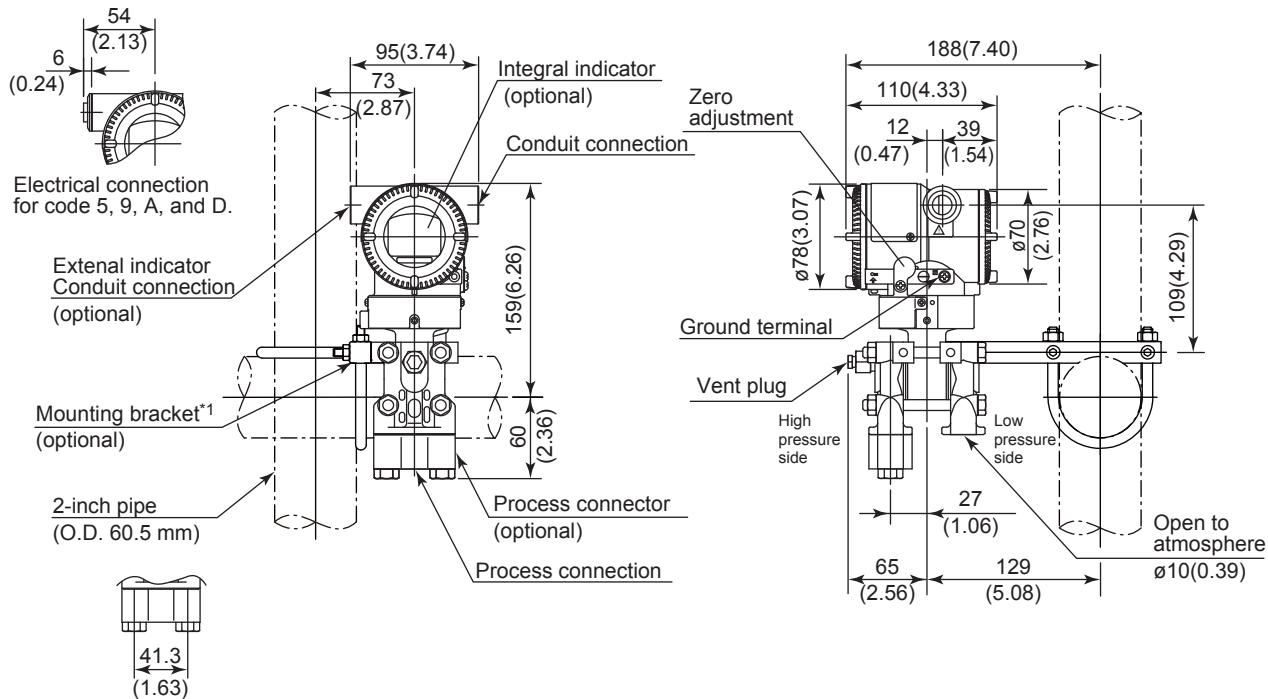

\*1: A transmitter with SST housing is not applicable for mounting to horizontal 2-inch pipe.

\*2: When electrical connection code 7 or C is selected, a blind plug is protruded up to 8 mm from the conduit connection.

- Terminal Configuration

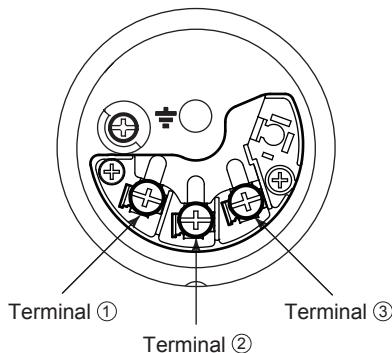

- Terminal Wiring for 4 to 20 mA output, FOUNDATION Fieldbus and PROFIBUS PA communication types

SUPPLY	+	①	Power supply and output terminals
CHECK	+	③	External indicator (ammeter) terminals*1*2
	-	②	
			Ground terminal

\*1: When using an external indicator or check meter, the internal resistance must be 10 Ω or less.

\*2: Not available for FOUNDATION Fieldbus and PROFIBUS PA communication types.

- Terminal Wiring for 1 to 5 V output

SUPPLY	+	①	Power supply terminals
VOUT	+	③	1 to 5 V DC with HART communication
	-	②	terminals
			Ground terminal

Three or four wire connection. For four wire connection, both supply and signal lines use SUPPLY - terminal.